5 MAS rouse

SECT		phod	05			Š	5 MAA 1838	200
1. CASE NO. 960118CNE5041					EPIDEMIOLOGIC INVESTIGATION			4
4. DATE OF INCIDENTYR NO DI 96 01 02	5. DATE I INITIAT 96 01	ED	YF	MO DAY	REPORT			
6. SYNOPSIS OF INCIDENT OR COLO On 1/2/96 a fire oc attributed to an el countertop in the k	curred a	counter-t	op tos	aster ov	en lo	cated	l on the	
7. I.OCATION (Home, school, etc.) Home 10	ood			9. STATE Florida		FL		
toaster oven=0216 Black & Decker House Road, Shelton, CT 06				e, MODEL NUMBER, MANUFACTURER & ADDRESS sehold Cooking Appliances,6 Armstrong 6484 No model # indicated.				
11B. TRADE/BRAND NAME, MODEL NUMBER, MANUFACTURER & ADDRESS N/A UNT.						TURER & ADDRESS		
999 MALE -1	SE NUMERIC 2 UNKNOW		no inju				ery diagnosis ery =70	
		MT(s) (Mother, ment, home		18. TYPE IN ON SITE - TELEPHONE OTHER -:	1 - 2	TION	19. TIME SPENT 17.0	
20. ATTACHMENTS multi = 9		source ident repor		22. REVIEWI			YR MO DAY 96 02 27	
23. PERMISSION TO DISCLOSE NA (NON-NEISS CASES ONL	MES Y) CPSC MA						MY NAME [X] TOR REVIEW DATE	
24. NARRATIVE (See Instructions				£08	18		2/27/46	
BACKGROUND: This i #960118CNE5041 to f (see assignment bac report was obtained of the incident reports oven was obtained to a ster oven was obtained to be a sterious or the sterious steriou	ollow-u kground during ort and tained	p fire in Exhibit contacts interview from the	nciden t 4). s to t ew wit fire	t report Informa he fire h the in departme	/CPSC tion depar vesti	Inc: conta tment gatin Visi	ident #N61-0014A ained in this to obtain copying officer.	
scene did not resul Subsequent telephon information was ava	e conta					wner	; limited // //	nade
						И	FRIPRYLAR NOTIFIED Comments at	tice
CPSC FOR NO. 182 (Revised 10/	93)(Adapted	for WP for N	findows &	Epson LQ-10	70 Prin	ter 10/	93) (urher	

960118CNE5041 -2-

PRE-INCIDENT:

This fire incident occurred in a single-family house in Hollywood, FL. The homeowner described the house as a 4-bedroom, 2-bath home constructed of concrete block/stucco. The home was residence to the 31-year old male home owner and a 19-year old male roommate.

According to the homeowner, an electric counter-top toasteroven was received new as a gift from his mother about 5 years ago and had been used almost daily to make toast or heat foods. It was kept plugged into an AC wall outlet having 6 outlets. According to the homeowner, over the last month or so the toast mode slide switch stuck in the ON postion on a couple of incidents. After the bell rang indicating completion of the toast cycle, the switch stayed down and he had to flip the switch up.

According to the homeowner, there had never been any smoking or burning problems with the toaster-oven. There had never been any repairs performed.

According to the homeowner, the last time the toaster-oven had been used was a couple of days before the fire incident. He had made toast without problem or incident.

Other appliances plugged into the outlet series included a refrigerator, dishwasher, coffee maker, and table-top fan. According to the homeowner, there had been no problems with the branch circuitry, the outlet or any of the other appliances.

On the day of the fire incident—1/2/96, the homeowner and roommate had left the house at about 6:30AM for work. There were no occupants in the house at the time of the fire.

INCIDENT:

According to the fire investigator, the fire incident occurred after 1:00PM on 1/2/96. Cause of the fire was attributed to the toaster-oven on the counter-top in the kitchen. According to the homeowner, property damages exceeded \$5000 to the toaster-oven, counter-top, dishwasher, cabinets in the kitchen and other smoke damages in the house. There were no injuries.

POST-INCIDENT:

According to the fire investigator, the fire department received an alarm call and responded to the scene and extinguished the fire. Fire department investigation identified the source of the fire to be the toaster-oven on the counter-top in the kitchen. The toaster-oven was collected by the fire department.

960118CNE5041 -3-

or a series of the series

PRODUCT INFORMATION:

According to the homeowner, the toaster-oven was received new as a gift about 5 years ago. According to the homeowner, his mother had purchased it at a Service Merchandise store. According to the homeowner, the use/care booklet and product carton had been discarded by him. The homeowner identified the brand of the toaster-oven to be Black & Decker.

CPSC investigator examination of the fire damaged toasteroven discloses that the metal housing measures approximately 14
3/4" long X 7 1/4" high X 7 5/8" deep (top) and 8 5/8" deep
(bottom). There is a front swivel-down door; the glass window in
the door and the door knob are missing as a result of the fire
damage. There is a plastic rotary selector knob with markings on
the adjacent face plate area that read "OFF...200...DEFROST
...300...BAKE...400...500...BROIL". There is a vertical slide
switch for the toast cycle with an indicator light. To actuate
the toast cycle the switch is slid downward. There is a plastic
rotary knob for the toast lightness/darkness setting with
markings on the adjacent face plate area that read "LIGHT...TOP
BROWN...DARK".

According to the fire investigator, the position of the toaster cycle in the OFF position and the bake cycle in the OFF position with toast darkness setting in the mid-range were the positions of the control switches at time of discovery and removal from the residence by the fire department.

The bottom swivel access door was separated from the housing. Markings on the bottom surface of the door read "PULL TO OPEN DISCONNECT TOASTER BEFORE CLEANING 120 VOLTS 1500 WATTS 50 - 60 Hz A.C. ONLY HOUSEHOLD USE ONLY UL TOASTER LISTED 228E".

Right side panel and front/bottom piece are also separated due to the fire damages.

Power supply cord with plug measures approximately 30" long. Two wire cord has stranded copper wiring with crimp terminal connector on one wire and connector missing on other wire. Brown cable insulation has markings "VEWC CORP---VICTOR CORP 16/2 SWG TYPE HPN HEATER CORD CSM". Male plug has two non-polarized prongs. One prong bears marking on side "746". On end of plug housing it reads "F VICTOR CSA".

Interior cooking cavity has wire rack that is attached to door and slides outward when door is opened. There are no evident markings in the interior area.

There are no evident markings or labelling on the product showing the product brand. Brand name is believed to have been present on the glass panel in the oven door.

The homeowner had no use/care booklets, product carton or other product literature.

CONTACTS TO FIRE DEPARTMENT:

Contacts to the fire department allowed collection of the fire incident/investigation reports and interview with the fire investigator. The toaster-oven was provided to CPSC. Scene photographs were not provided. According to the fire investigator, the branch circuitry, dishwasher, coffeemaker, fan and refrigerator were not involved in the fire. The circuit was not overloaded.

CONTACT TO HOMEOWNER:

Visit to the residence and numerous attempts to locate the homeowner subsequently led to telephone contact. Only limited information was available. No scene examination was available. No authorization for release of name was obtained.

CONTACT TO UL:

Contact to Underwriters Laboratories, Inc., 333 Pfingsten Road, Northbrook, IL 60062 at (847)-272-8800 disclosed that UL List 228E is registered to Black & Decker Household Cooking Appliances, Shelton, CT. Should CPSC have information to refer to UL, it can contact Brian Monks, UL/New York--Long Island at FAX=(516)-439-6012.

STANDARDS INFORMATION:

There are no mandatory CPSC standards covering toasterovens. Markings on the housing of the toaster-oven reference UL. Current UL specification covering toaster-ovens is UL 1026-95--Standard for Safety Electric Household Cooking and Food Serving Appliances.

ATTACHMENTS TO REPORT:

- 1 Photocopy of fire report (5 pages)
- 2 Photographs 1-14 taken by CPSC investigator showing fire-damaged toaster-oven
- 3 Photocopy of C/R 96-800-2733
- 4 CPSC Incident #N61-0014A assignment background

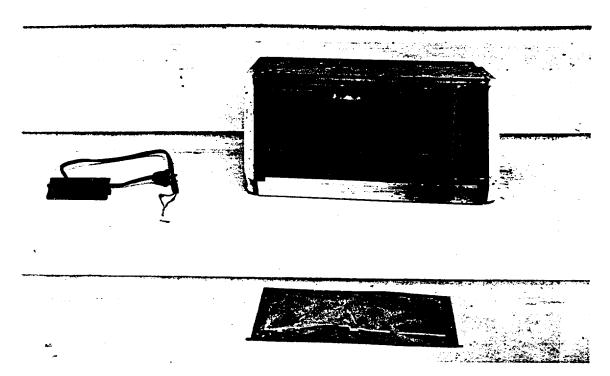


PHOTO 1 (Above): View of toaster-oven and separated components.

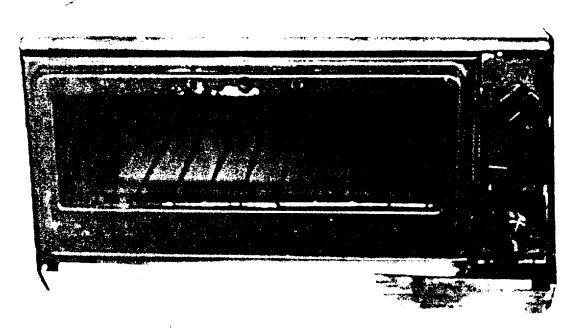


PHOTO 2 (Above): Closer view of front of item.

GEXHIBIT 2 GIANIRONESOYI

the product weeks after the Photos 1-14 are photographs taken by CPSC investigator showing fire-damaged toaster-oven after Fire Dept. referral of item to CPSC custody and reflect conditions of NOTE:

fire incident.

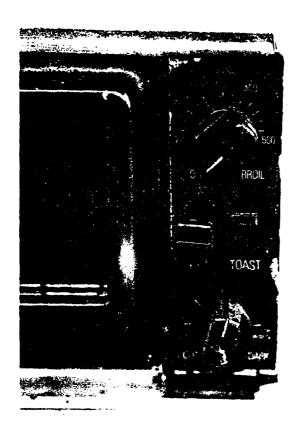


PHOTO 3 (Above): Closer view of control panel area.

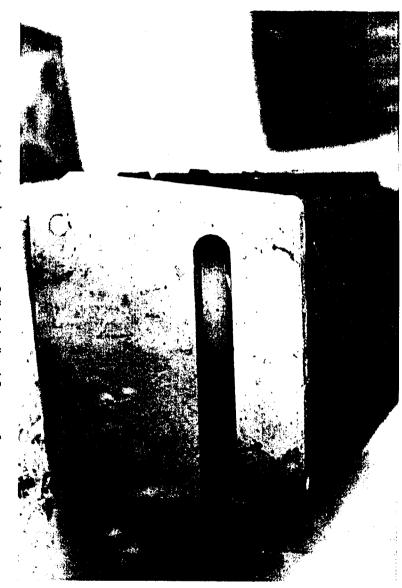


PHOTO 4 (Above): View of "right" side panel.

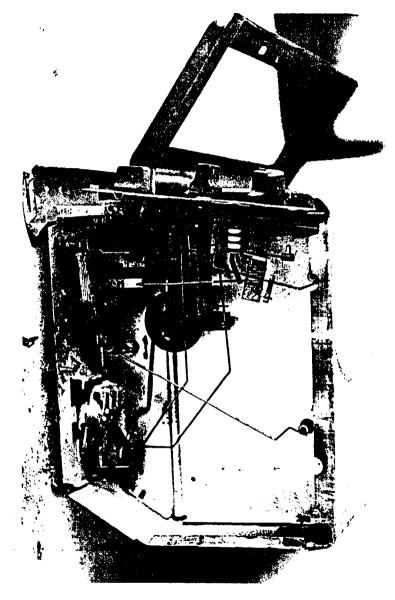


PHOTO 5 (Above): View of interal wiring/components on right side.

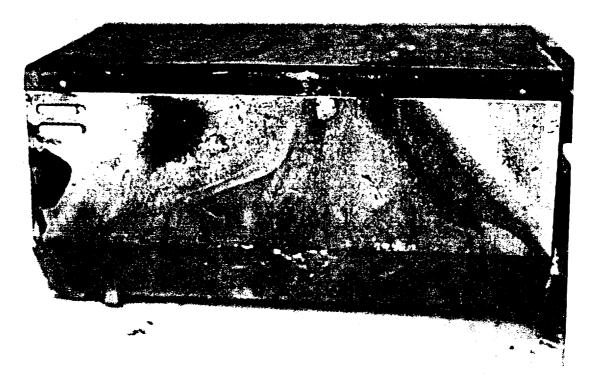


PHOTO 6 (Above): View of back panel.

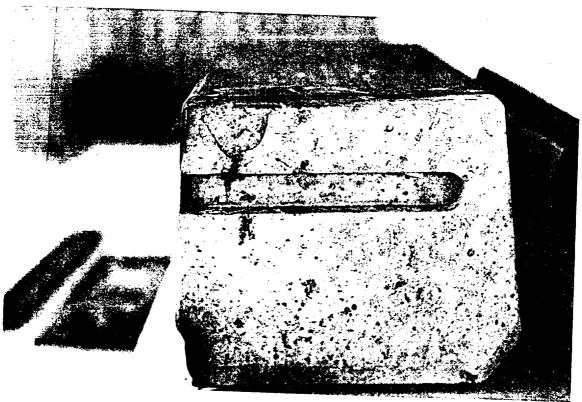


PHOTO 7 (Above): View of "left" side.

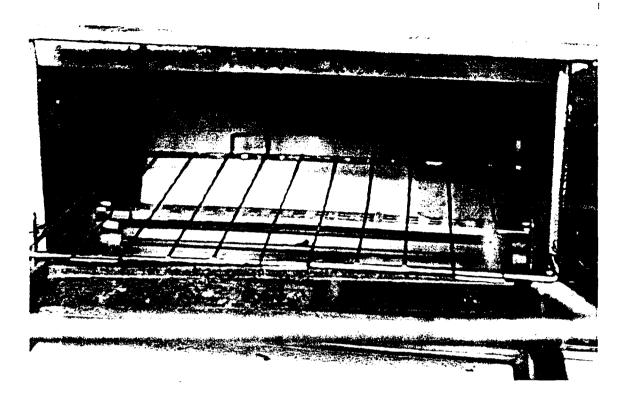


PHOTO 8 (Above): View of interior cavity area.

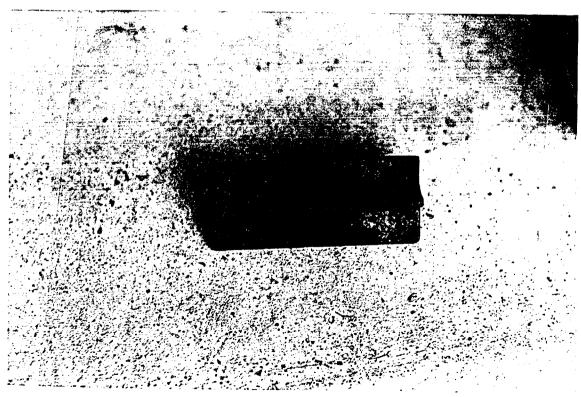


PHOTO 9 (Above): View of door handle.



PHOTO 10 (Above): View of bottom surface of product bottom.


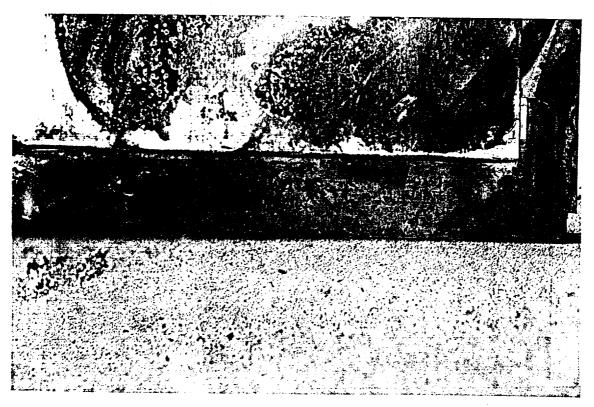


PHOTO 11 (Above): Closer view showing markings.



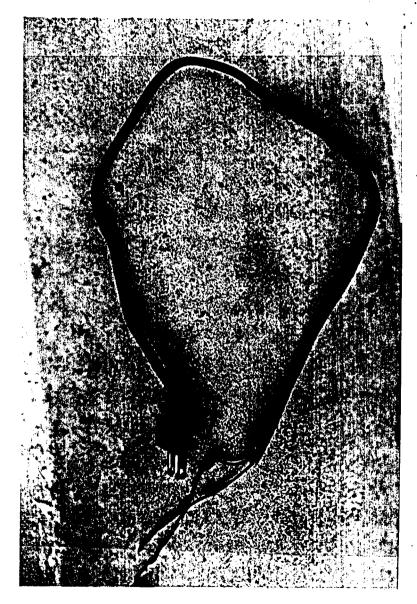

960118 CNE 5041



PHOTO 14 (Above): Closer view of end of plug.

960/18 CNE 5041

FIRNF010 HWF

CITY OF HOLLYWOOD - LIVE RMS FIELD INCIDENT REPORT

Page # 3 01/16/96

01/03/96 F0071 FIRE CAPTAIN
REPORT WRITTEN BY [W] DOWELL, DONALD

OTHER INVOLVED PERSON INFORMATION

EMS DETAIL (Name)

=== NARRATIVE ===

=== NARRATIVE ===

NARRATIVE BY: CAPTAIN DOWELL ON E-45

96-102

ARRIVED TO FIND STRUCTURE LOCKED UP WITH LIGHT SMOKE SHOWING FROM MOST OF THE WINDOWS. FORCIBLE ENTRY THROUGH BACK DOOR BY REMOVING ONE OF THE GLASSES AND REACHING IN AND OPENING THE DEAD BOLTS. ONCE INSIDE IT WAS DETERMINED THAT THE FIRE WAS UNDER AND BEHIND THE COUNTER TOP AND CABINET AREA WHERE THE DISHWASHER WAS.

POWER TO THE BUILDING WAS SHUT OFF BY REMOVING THE BREAKERS AND THE COUNTER TOP AREA DISMANTLED AND THE DISHWASHER PULLED OUT. THE WALL BEHIND THIS AREA WAS OPENED UP AND THERE PROVED TO BE NO EXTENSION. THE FIRE DID BURN UP INTO THE CABINETS AND BURNED THROUGH THE BOTTOM OF THE CABINET. INVESTIGATION REVEALED A HOLE IN THE COUNTER TOP THE SIZE OF THE TOASTER OVEN. IT APPEARS THAT IT WAS LEFT ON AND EVENTUALLY BURNED THROUGH THE COUNTER TOP AND THEN THIS IN TURN STARTED THE WALL ON FIRE BEHIND THE DISHWASHER. NO MAKE, BRAND OR SERIAL NUMBER COULD BE DETERMINED FROM THE TOASTER OVER.

ON CALL INSPECTOR CALLED AND ALSO HPD TO SECURE THE STRUCTURE. E-45 RETURNED TO SERVICE AND LEFT THE STRUCTURE WITH INSPECTOR PHILLIPS..

EXHIBIT / 960118 CNE 5041

OFFICIAL FIRE DEPARTMENT REPORT

 
fecurial 01/03/16

6241 Eletaer St.

•

Run & 96-102 Structure Accident

On Tuesday, January 2-01 1996 cot 1345 hrs. I was contacted by fire Dispatch with a reguest for a fire investigator to respond to:



Responding in Unit "199, This investigator armed on scene at MOY his, and met with:

Capt. D. Dowell

E-C, 45

who informed this mestigetor

of the following.
Station"45 units arrived on scene & a single family residence and extinguished a dire in the Kitchen area incluing a dishurcher, contectop, and kitchen cabinets. Capt. D. Dowell also advised that no one was at home. Also on Scere was;

Officer Samuel Osborne Bodge * 1485 Hollywood Police Dept.

Officer Osberne artisad this investigates that he was trying to contact the honeowner. This writer began the physical incestingation in the kitchen and retach the tollowing

960118CNE5041

A G.E. Dishwaster, model unknown

had been pulled into the center of the kitchen
revealing fire demage to its insulation, the side
pand of the sink cabinet, vertending up the well
to the overhead cabinets. Also in the area was
a collect mater without any Fire damage which
had been on the countertop and removed by
fire Department personnel. This investigator
was advised by Capt. Dowell that the countertop
which was on top of the dishweder had received
fire damage and had been removed to the book
yard of the above residence. The

This investigator observed that

a 15" × 9" portion & the constartop had been bround completely through and that the underside portion consisting of particle board revealed a line travel extending outward.

Protos of the sience were

taken by this investigator at this time.

This mestignator questioned

Fire personnel if anything else had been removed from the courtertop above the distinct and was advised that a toaster oven had been removed and placed on the Kitchen Floor.

Reconstructing the fine scene.

Lit right in where the countertop had been burned through.

The toaster/over:

Black & Decker

No model *

No social "

had considerable line damage to
the inderside, with damage to the sides, the electric
power cord and also it was noted that the glass
door was brother at toerto heat building
Officer Osberne advised this

neestigater that he had contacted the homeowner via the telephone and that the owner would be home in approximately 30 minutes.

At 1506 hrs.;

Daniel Newcomb Blyow/m

DOO 3/17/64

Phone (954) 961-4997

55. " 054-58-7964

this investigator that he was the honeowner.

With mr. Newcomb was:

Eryk Temlack 1970. W/m

10/8/76

55* 761-57-1580

who stated that he also lived

and the control of th

During questioning. We Newcomb statud that he is self-employed as a disjust installer and that Mr. Temlack is his halper. Mr. Newcomb further stated that they both least for work at approximately 0630 hrs., returning home after being contacted by afficer Osborne. When questioned in regards to the toaster/oven, Mr. Newcomb stated that the toaster switch had to be apprehical manually but had not been used recently.

and the contract of the contra

This investigator took possession of the tooster over and has tried to contact the U.S. consumer Product Salety Commission to see it problems recording this with have been noted. It is this investigator's opinion

that this him be classified as accidental based on the physical evidence and Mr. Newcomb's statement

EXHIBIT 3 960118 CNE 5041

	U.S. Consumer I	Product Sa COLLECTI	nety Commiss On REPORT	ion						
1. Sample Flag DI 960118CNE5041	2. Date (2/20/96	Collected	3. Sample Type Physical	ber: 96-800-2733 cumentary						
la Product Name OASTER-OVEN	4b Mode NOT IND	- 1	4c NEISS 0216		5. Assignment Number 960118CNE5041					
i. Complete for Import Samples			7. MIS 8. Hours		urs Activity 3					
			32626		Travel 1					
Country of Origin: Entry No. and Date:			9a Home RO	9b C	ollecting RO					
Customs Contact:			FOER	FO	ER					
0. Sample Cost \$0.00	11. Invoice Val	ue of Lot		Lot Units 1 unt						
3. Manufacturer/Importer #BLA028 BLACK & DECKER 3 ARMSTRONG ROAD SHELTON, CT 06484	14. Shipper/For N/A	. Shipper/Foreign Manufacturer 'A 15. Dealer/Import Broker FIRE DEPT. RE IDI 960118CNE5041								
6. Supporting documents attached:	1			<u> </u>						
Involce No. and Date: N/A Date Shipped: Shipping Record and Date: N/A Affidavit Signer's name, title and date: N/A										
8. Reason for collection/analysis need Collected from fire dept. as part of Summary of Field Screening: Item not screened.	ed: FHSA	● CP		\ Р	PPA RSA					
O. Sample size/Method of Collection: Sample was obtained from fire departs Unit is being identified with bar co- in plastic bag, taped closed, official	le sticker. Sample	is being	placed							
1. Identification on sample: 96-800-2733		tification on se 2733 Paul E. P								
3a Sample delivered to: UPS, FT. LAUDERDALE,FL	PEP 2/20/96	23b Date 2/21/96		nt to:						
5. Laboratory/Office: LSHLLSEL	CRM (CCA_X_	Other _							
5. Remarks: See IDX. 7. Related Samples: none	UNIT		Outer .							
1000		1001 0 11								
Ba Collector's name/title: aul E. Phillips Sr. Resident	lent Investigator	280 CD	Paul & Phillips 7/21/96							
Pa Reviewer's name/title:		29b Rev	eviewer's signature/date:							

CONTINUATION OF NARRATIVES FOR SAMPLE #

96-800-2733

960118 CNE 5041

PRODUCT IDENTIFICATION

Appliances. Shelton. CT.

METHOD OF COLLECTION

for shipment via Sample Custodian to CCA. Attn: Cathy Downs.for

Paul Phillips

FIRNF010 HWF CITY OF HOLLYWOOD - LIVE RMS FIELD INCIDENT REPORT Page # 3 01/16/96

01/03/96 F0071 FIRE CAPTAIN REPORT WRITTEN BY [W] DOWELL, DONALD

OTHER INVOLVED PERSON INFORMATION

EMS DETAIL (Name)

=== NARRATIVE ===

=== NARRATIVE ===

NARRATIVE BY: CAPTAIN DOWELL ON E-45

96-102

ARRIVED TO FIND STRUCTURE LOCKED UP WITH LIGHT SMOKE SHOWING FROM MOST OF THE WINDOWS. FORCIBLE ENTRY THROUGH BACK DOOR BY REMOVING ONE OF THE GLASSES AND REACHING IN AND OPENING THE DEAD BOLTS. ONCE INSIDE IT WAS DETERMINED THAT THE FIRE WAS UNDER AND BEHIND THE COUNTER TOP AND CABINET AREA WHERE THE DISHWASHER WAS.

POWER TO THE BUILDING WAS SHUT OFF BY REMOVING THE BREAKERS AND THE COUNTER TOP AREA DISMANTLED AND THE DISHWASHER PULLED OUT. THE WALL BEHIND THIS AREA WAS OPENED UP AND THERE PROVED TO BE NO EXTENSION. THE FIRE DID BURN UP INTO THE CABINETS AND BURNED THROUGH THE BOTTOM OF THE CABINET. INVESTIGATION REVEALED A HOLE IN THE COUNTER TOP THE SIZE OF THE TOASTER OVEN. IT APPEARS THAT IT WAS LEFT ON AND EVENTUALLY BURNED THROUGH THE COUNTER TOP AND THEN THIS IN TURN STARTED THE WALL ON FIRE BEHIND THE DISHWASHER. NO MAKE, BRAND OR SERIAL NUMBER COULD BE DETERMINED FROM THE TOASTER OVER.

ON CALL INSPECTOR CALLED AND ALSO HPD TO SECURE THE STRUCTURE. E-45 RETURNED TO SERVICE AND LEFT THE STRUCTURE WITH INSPECTOR PHILLIPS...

SECT 15

960118CNE 5041

EHDS GP. I FOERCF

NG1-0014A

EXHIBIT 4 960118 CNE 5041